

Work Order ID 116473

April-16-14 12:48:08 PM

116473

Page 1

Item ID: D206-667-103TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 4/16/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/01/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLS Date: 11-04-16 Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D206-667-143	Rev C
--------------	-------

100

MORI SEIKI CNC LATHE LARGE

0.00

100

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AB

DWG REV: C

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 - ϕ - KC
mm L
14/05/07

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 - ϕ - KC
mm L
14/05/07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube <input type="checkbox"/></td> <td style="width:15%;">Crosstube <input type="checkbox"/></td> <td style="width:15%;">Water Jet <input type="checkbox"/></td> <td style="width:15%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design <input type="checkbox"/>									
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Handling/Pre <input type="checkbox"/>									
Material <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Offset/Setup <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Transport <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 116473

April-16-14 12:48:08 PM

116473

Page 2

Item ID: D206-667-103TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/16/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/01/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

120

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1-Turn second side as per Folio FA087

2-File down transition lines smooth.

3-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

FOLIO REV: AB

DWG REV: C

*Do not use sandpaper coarser than 320 grit.

0.00

0.00

130

130

QC

Quality Control

QC1- Inspect dimensions to dimension sheet

Memo

0.00

0.00

MML
14/05/09

MML
14/05/09

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 116473

April-16-14 12:48:08 PM

116473

Page 3

Item ID: D206-667-103TRN

Revision ID:

Item Name: Crosstube Turning Detail

Start Date: 4/16/14 Start Qty: 1.00

Required Date: 5/01/14 Req'd Qty: 1.00

Reference:

Accept

N900040100

Setup Start ***NS1***

Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control									
145		0.00							
145									
Crosstubes	Memo	0.00							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

W 14-05-12

JS 14-05-12

BL 14-05-14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 116473

April-16-14 12:48:08 PM

116473

Page 4

Item ID: D206-667-103TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Crosstube Turning Detaill

Stop *NS2*

Start Date: 4/16/14 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 5/01/14 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

27

9-89

14/5/20

Quality Control

170

Packaging

0.00

170

Packaging

Memo

0.00

Identify and stock in kanban rack Location:

LG

Packaging

BL/LW 14-05-20

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

14/5/20 MF 14-5-20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

April-16-14 12:48:10 PM

Page 1

Work Order ID: 116473

116473

Parent Item: D206-667-103TRN

D206-667-103TRN

Parent Item Name: Crosstube Turning Detaill

Start Date: 4/16/14

Required Date: 5/01/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 removed polish EC verified by DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6002-115		Manufactured	No			110	Each	43.0000	1	1			

D6002-115

Crosstube Material

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG003	43	
69794	15	
75629	7	
75637	8	
75645	13	

KC 14-06-06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--


DART AEROSPACE LTD	Work Order:	116473
Description: Crosstube Assembly (206L High Fwd)	Part Number:	D206-667-143
Inspection Dwg: D206-667-143 Rev: C		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.240	/		mic CMC-04
	1.982	+0.005/-0.000	1.996	/		vern CMC-08
	2.019	+0.005/-0.000	2.024	/		mic CMC-04
	2.058	+0.005/-0.000	2.063	/		
	2.097	+0.005/-0.000	2.103	/		
	2.136	+0.005/-0.000	2.140	/		
	2.176	+0.005/-0.000	2.181	/		
	2.201	+0.005/-0.000	2.205	/		
	0.125	+/-0.010	.125	/	vern	CMC-08
	0.400 x 30°	+/-0.010	.400 x 30	/	"	
	R0.063	+/-0.010	.063	/	RG	
	R0.500	+/-0.010	.500	/	"	
	4.438	+/-0.030	4.430	/	vern	CMC-08
SIDE B	104.98	+/-0.020	104.98	/	TAPE	LGL-11
	2.240	+0.005/-0.000	2.240	/	mic	CMC-04
	1.982	+0.005/-0.000	1.985	/	vern	CMC-08
	2.019	+0.005/-0.000	2.024	/	mic	CMC-04
	2.058	+0.005/-0.000	2.063	/		
	2.097	+0.005/-0.000	2.103	/		
	2.136	+0.005/-0.000	2.140	/		
	2.176	+0.005/-0.000	2.179	/		
	2.201	+0.005/-0.000	2.204	/		
	0.125	+/-0.010	.125	/	vern	CMC-08
	0.400 x 30°	+/-0.010	.400 x 30	/	"	
	R0.063	+/-0.010	.063	/	RG	
	R0.500	+/-0.010	.500	/	"	
	4.438	+/-0.030	4.430	/	vern	CMC-08

DART AEROSPACE LTD	Work Order: 116433
Description: Crosstube Assembly (206L High Fwd)	Part Number: D206-667-143
Inspection Dwg: D206-667-143 Rev: C	Page 2 of 2

WALL THICKNESS MEASUREMENT

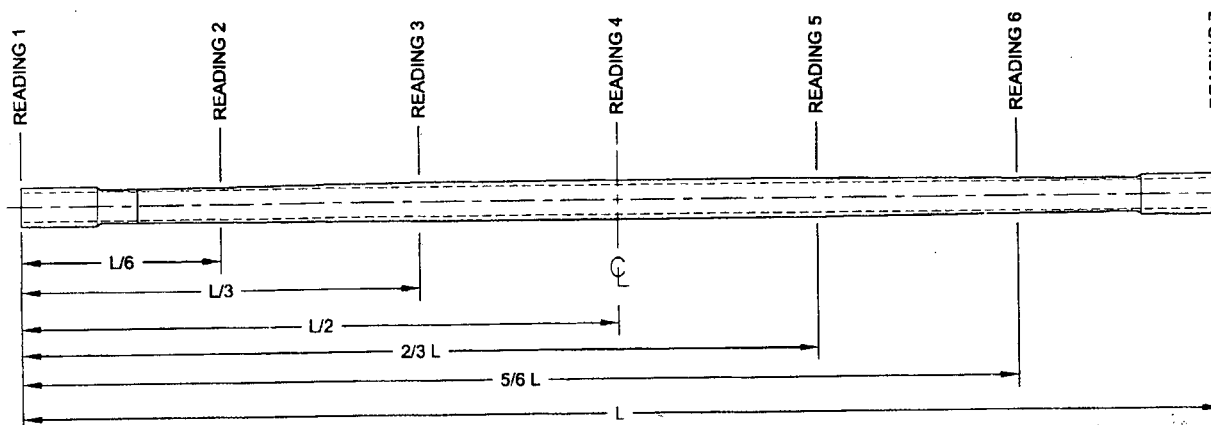

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.250	.258	.259	.253	.009	0.035"
READING 2 L = 17.500	.177	.182	.178	.171	.011	
READING 3 L = 35.00	.251	.258	.253	.248	.010	
READING 4 L = 52.500	.267	.264	.258	.256	.011	
READING 5 L = 70.00	.255	.251	.244	.246	.011	
READING 6 L = 87.500	.186	.186	.174	.167	.019	
READING 7 L = 104.500	.256	.258	.255	.250	.008	

Calibration Result

Actual Block Thickness: .100 - .500

Sitiescan 250 Measured Thickness: .100 - .500

Measured by: AMM.L Date: 14/05/09	Audited by: JH Date: 14-05-12	Preliminary Approval: Date:
--	--	--

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	10.09.13	Dwg Rev updated	KJ	
D	12.06.04	Wall thickness form added	KJ	

Item	Qty -143	Part Number	Description
1	X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 104.98±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-143" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 15.5 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

D206-667-103 TRA

D6002-115

105.23

11
JAWS
LOAD
PSM
STEADY MAT 1/2

01/11/03

DEO ATTACHED RELEASED
08/11/12


C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D3856-400-694 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCE (ZN D3-3, C4-3, C5-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF		
DRAWN	RF		
CHECKED	RF		
MFG. APPR.	RF		
APPROVED	RF		
DE APPR.	RF		
DATE	08.11.06		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D206-667-143
REV. C
SHEET 1 OF 4

TITLE
CROSSTUBE ASSY (206L HIGH FWD) NTS

COPYRIGHT © 2006 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

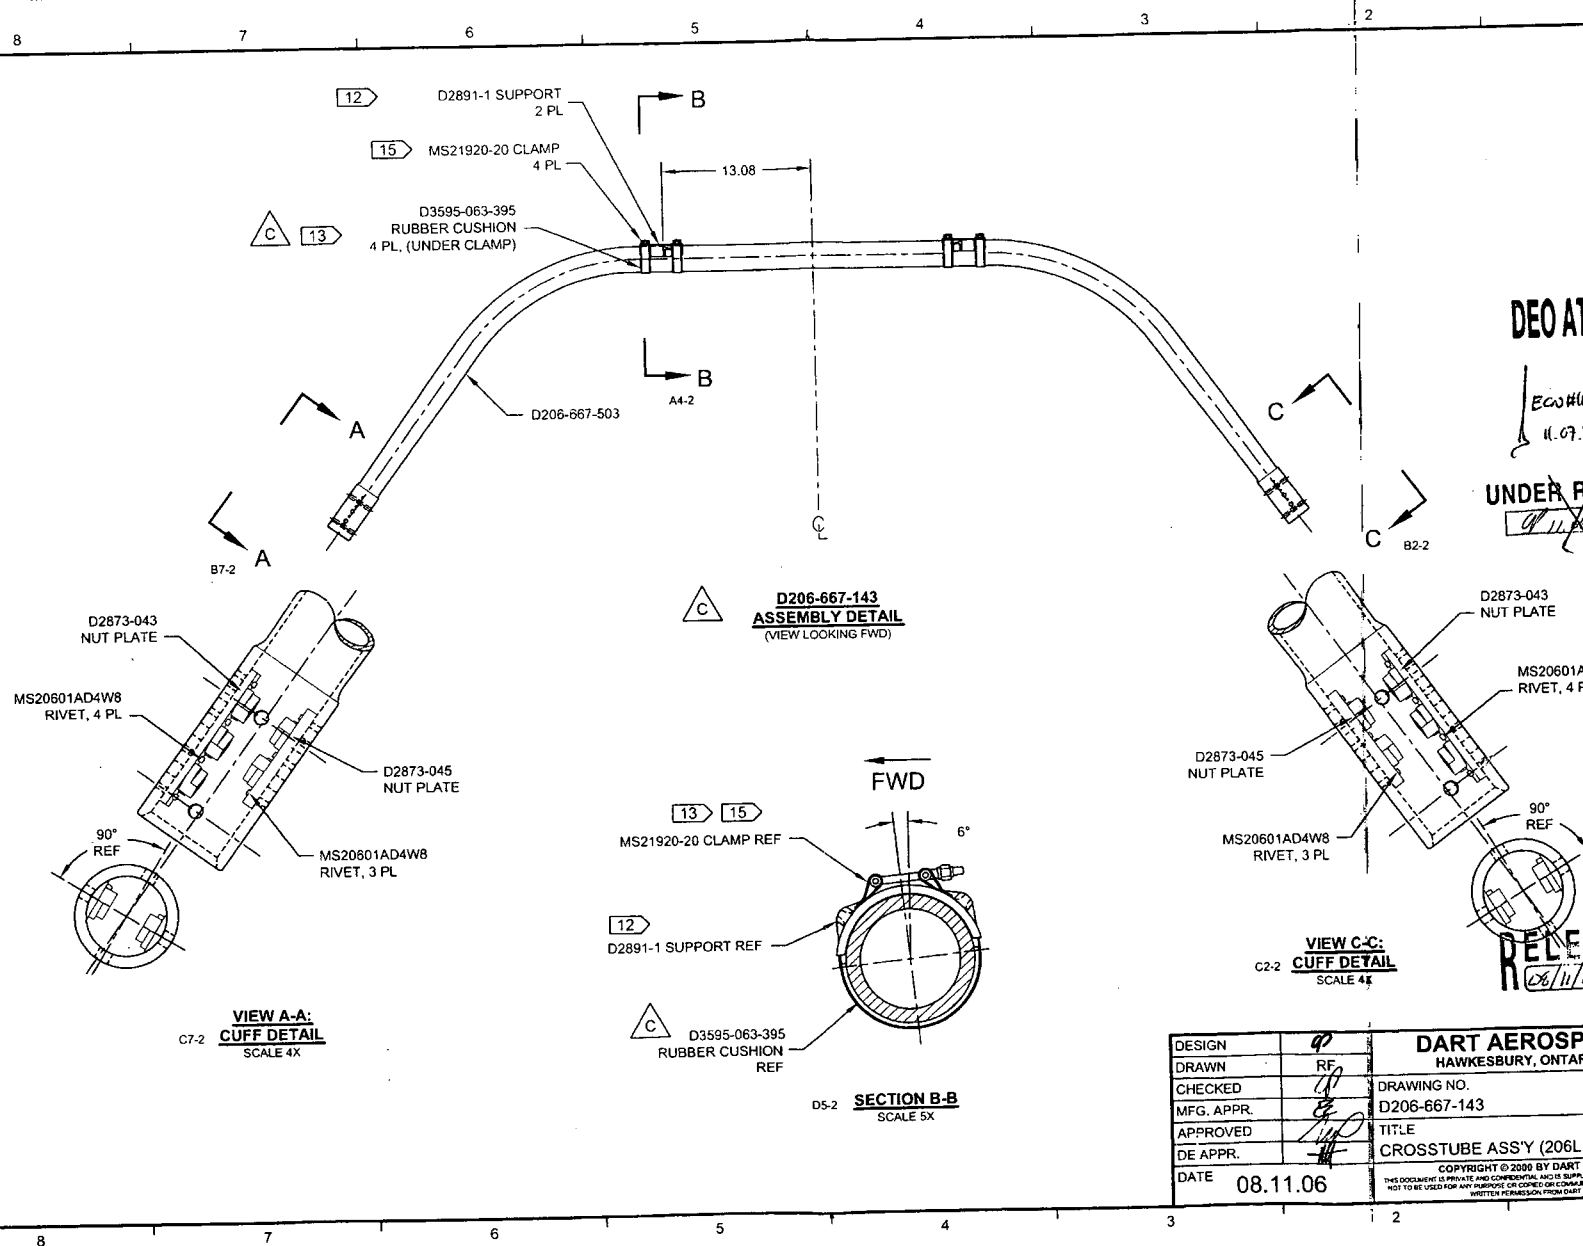

DEO ATTACHED

ECWHL-615
11.07.26

UNDER REVIEW

08/11/12

D206-667-143
ASSEMBLY DETAIL
(VIEW LOOKING FWD)


VIEW A-A:
CUFF DETAIL
SCALE 4X

SECTION B-B
SCALE 5X

VIEW C-C:
CUFF DETAIL
SCALE 4X

RELEASED
08/11/12


DESIGN	9P	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	CP	D206-667-143	SHEET 2 OF 4
MFG. APPR.	EP	TITLE	SCALE
APPROVED	EP	CROSSTUBE ASSY (206L HIGH FWD)	NTS
DE APPR.	EP	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		

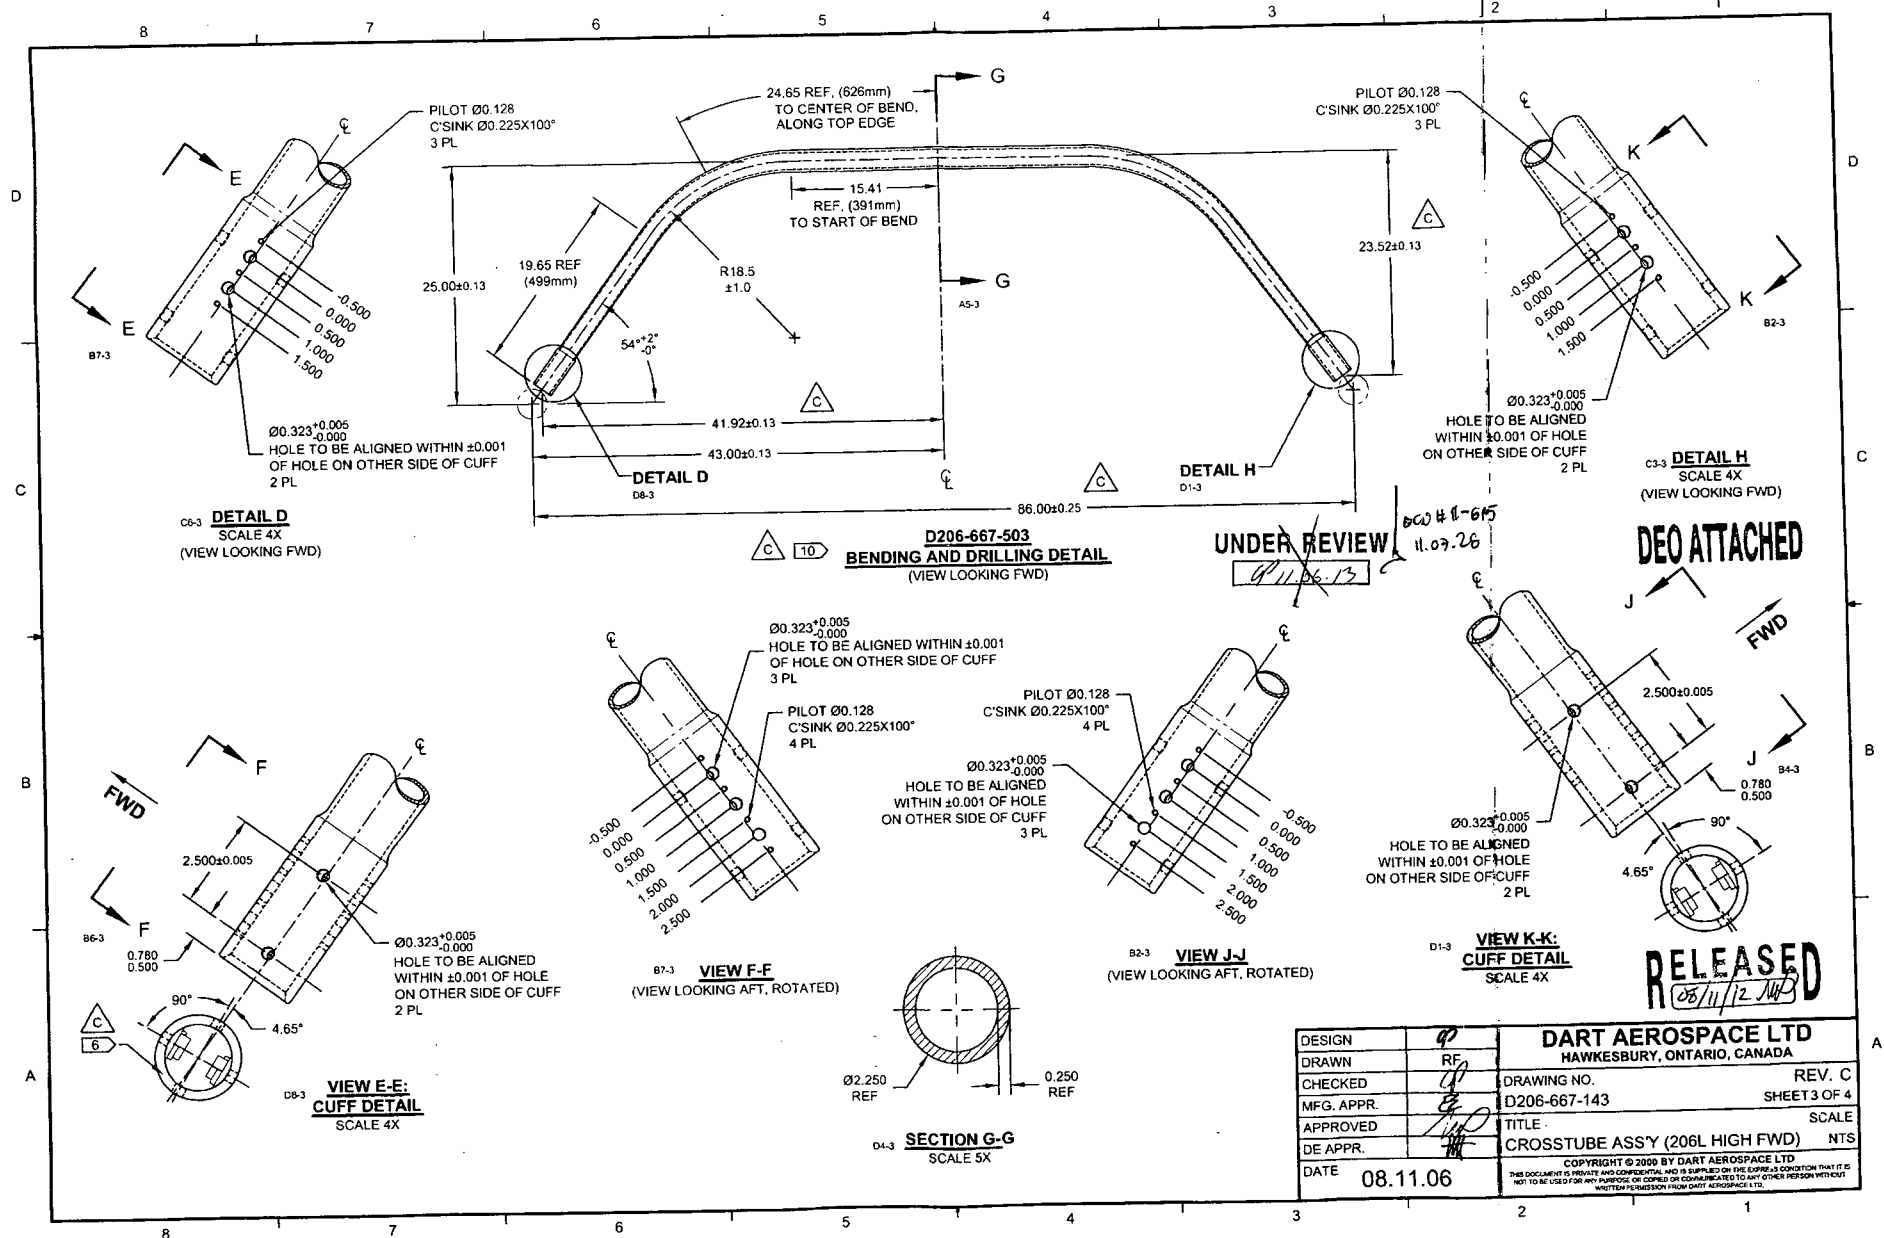

DEO ATTACHED

RELEASED
08/11/12 JUP

UNDER REVIEW
08/11/06-13
11.07.26

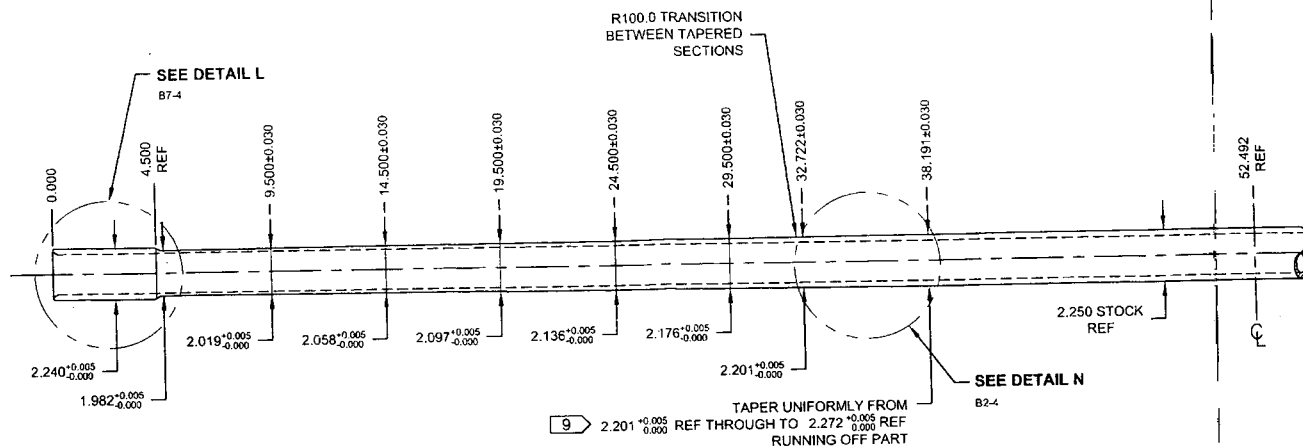


PCO #11-615
11.07.26


UNDER REVIEW

DEO ATTACHED


TURNING DETAIL

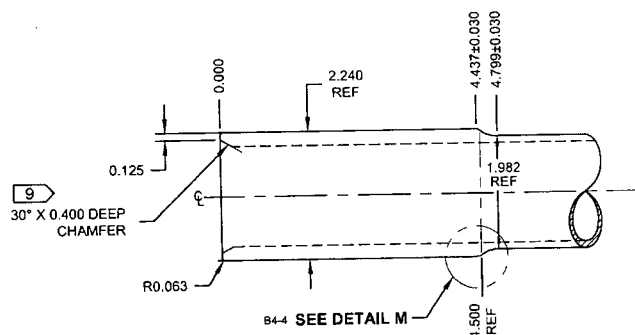

DETAIL L:
CROSSTUBE CUFF
NOT TO SCALE

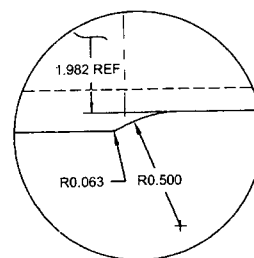

DETAIL M:
CUFF TRANSITION
NOT TO SCALE

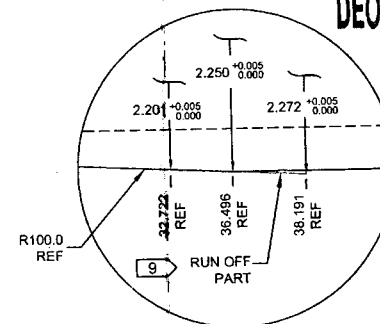

DETAIL N:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
08/11/12

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	UP	DRAWING NO.	REV. C
MFG. APPR.	UP	D206-667-143	SHEET 4 OF 4
APPROVED	UP	TITLE	SCALE
DE APPR.	UP	CROSSTUBE ASSY (206L HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

DRAWING NO. D206-667-143	TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-143-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -143	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2891-1 SUPPORT: ABRABE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
[Signature]

DRAWING NO. D206-667-143	TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D206-667-143-C-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12-08-02		

PURPOSE:

ADD ELECTRICAL GROUNDING STRAP

CHANGE:

PARTS LIST:

ITEM	QTY -143	PART NUMBER	DESCRIPTION
1	X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
10	2	AN742D36	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27039-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN960C10L)


ADD

GENERAL NOTES:

- 16) MASK AREA UNDER CLAMP PRIOR TO PAINTING
- 17) SEAL EDGES WHERE AN742D36 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241/-291 OR MIL-S-8802 CLASS B2 OR PROSEAL 890 SEALANT
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MILLIOHMS

ADD

RELEASED
CP 12.08.17
ECN 12-631

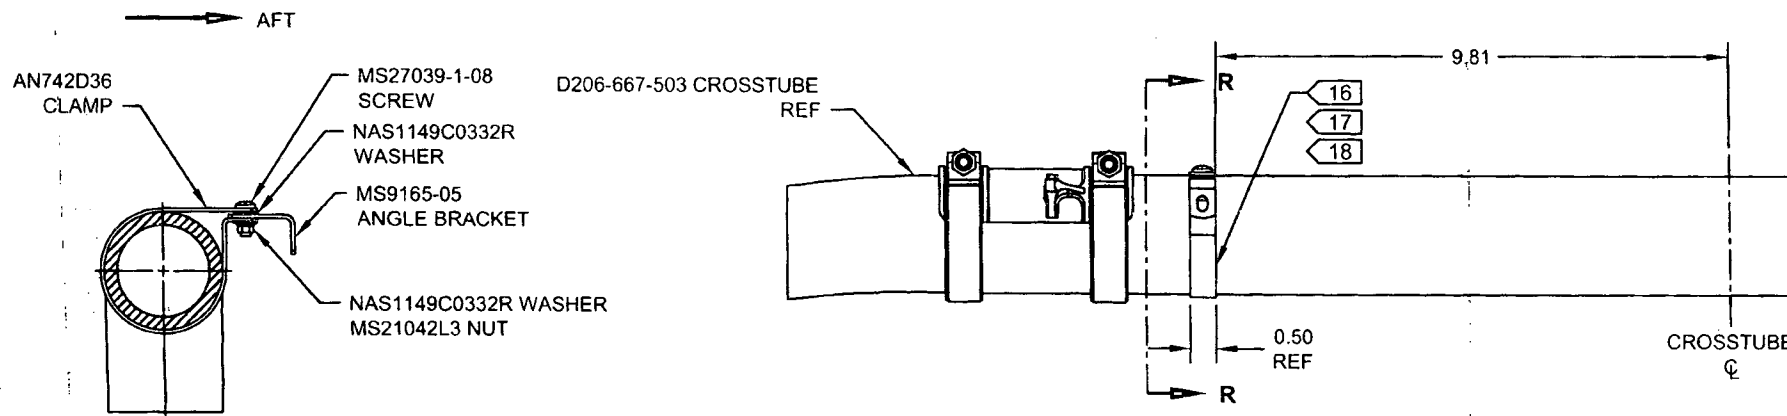

SECTION R-R

DETAIL P BONDING STRAP INSTALLATION 2 PL

COPYRIGHT © 2012 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

